


Wrong application of OPEL ignition coils and how to avoid it...

Codes **10326** and **10483** are externally similar but have a different internal circuit. When used one in place of the other, the engine misfires and soon the ignition coil is burned.

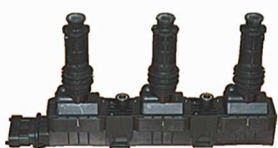

10326
OPEL AGILA (H00) 1.0 12V
 43Kw 58CV 973cc -->08.2003
CORSA B (73_, 78_, 79_) 1.0 i 12V
 40Kw 54CV 973cc
CORSA C (F08, F68) 1.0
 43Kw 58CV 973cc -->08.2003
 OPEL 01208306, 090532618,
 090543059

10483
OPEL AGILA (H00) 1.0
 44Kw 60CV 998cc -->02.2008
CORSA C (F08, F68) 1.0
 44Kw 60CV 998cc 09.2003 -->09.2006
CORSA D 1.0 48Kw 65CV 998cc
 1.0 44Kw 60CV 998cc
CORSA D Van 1.0 48Kw 65CV 998cc
 OPEL 024420622, 093180806

The same happens for codes **10327** and **10463**.



10327
OPEL AGILA (H00) 1.2 16V
 55Kw 75CV 1199cc -->06.2004
ASTRA G Caravan (F35_)
 1.2 16V 48Kw 65CV 1199cc
 1.2 16V 55Kw 75CV 1199cc -->09.2003
ASTRA G CC (F48_, F08_)
 1.2 16V 48Kw 65CV 1199cc
 1.2 16V 55Kw 75CV 1199cc -->09.2003
ASTRA G Stufenheck (F69_)
 1.2 16V 48Kw 65CV 1199cc
 1.2 16V 55Kw 75CV 1199cc -->09.2003
CORSA B (73_, 78_, 79_)
 1.2 i 16V 48Kw 65CV 1199cc -->08.2000
 OPEL 01208012, 090543253, 090560110

10463
OPEL AGILA (H00) 1.2 16V Twinport
 59Kw 80CV 1229cc -->02.2008
ASTRA H 1.4
 55Kw 75CV 1364cc 09.2004-->
 1.4 66Kw 90CV 1364cc -->03.2010
 1.4 LPG 66Kw 90CV 1364cc -->03.2010
ASTRA H Caravan 1.4
 55Kw 75CV 1364cc 09.2004-->09.2005
 1.4 66Kw 90CV 1364cc -->03.2010
 1.4 LPG 66Kw 90CV 1364cc -->03.2010
ASTRA H GTC 1.4
 55Kw 75CV 1364cc 09.2005-->02.2009
 1.4 66Kw 90CV 1364cc -->03.2009...*
 OPEL 01208020, 024420584, 93177212

For this reason, sellers cannot only base their choice on outside appearance but also on original code references.

Additional information:

10326 (3cil) and 10327 (4cil) are for Ecotec engines

10483 (3cil) and 10463 (4cil) are for Twinport versions